Approved For Release 2002/06/18: CIA-RDP74B00447R000200020007-2

U-AR #053
ACCIDENT
17 April 1969

_	Approved For Po			
	DICDATCH	I <mark>PASE 2002/06/18 : GIA RDP74B00</mark>	0447B000200020007-2 PROCESSING ACTION	
	DISPATCH	SECRET	MARKED FOR INDEXING	
1	Director, OSA		NO INDEXING REQUIRED	
ĺ	INFO.		ONLY QUALIFIED DESK CAN JUDGE INDEXING	-
- 1	FROM		CAN JUDGE INDEXING	
1	Commander, SUBJECT General: Accident F	Report Involving U-2R #0	MICROFILM	
-		nclusions and Recommends		nt
ľ	PROBLEM:			
1 Å	The protection of detach	nment assets while on de	eployment.	
	FACTS:			
ſ				
١				
١				
ı				
١				
ı				
ı				
ı				
ı				
ı				
ı				
ı				
ı				
ı				
ı				
ı				
1				
1				
۱				
1				
ı				
۱				
1				
	was not available and su	bsequent checks with th	ne Navy verified a sus	sn:
ľ		for delivery of the vehi		
			d to search out the wi	٠.,
		a member or one ceam had		
			working area (after 1	he:
	to the working level. A abouts of the forklift a		DATE	hei
	to the working level. A abouts of the forklift a	and delivered it to our		hei

S E C R E T

i	CANTINUATION OF	CLASSIFICATION	DISPATCH SYMBOL AND NUMBER	·	
	CONTINUATION OF DISPATCH	SECRET	UCLT-1553		
	coordinated the problem	with the Navy).			
25X1/	at which time it was paused to house the U-2R and on the apron when a move the U-2R out of the	ed constantly until approunted on the apron contigue. (Note Tab "A".) Work of approximately 2130 hours hangar onto the apron to positioning equipment.	ous to the hangar ontinued in the h s it was decided	angar to	
25X1	4. appeare	ed on the scene at 2135 ho			
23/11/	take the forklift back replied that he cany longer and with the round the aircraft tows and equipment placement	e nose where he asked to the Navy compound. (Ne could see no reason for us t remark, proceeded and the forklift (see Tab at time of the accident)	keeping the fork counter-clockwise "A" for flow patt . Meanwhile, sec	r. 25,17 lift a- 25 ,14	
25X1/	when he approached the cept him on his course	, so he doubled back to me	ted clockwise to	m the	
25X1	at this instance	ached the forklift, passed in a landrov around the aircraft.	started the enginger vehicle he was left the parking	using	
25X1	and began to follow continued in a straight	around the tail of t	the aircraft.	e apron	
25X1	at the corner of the he forty-five degrees to	angar. who could not the left after passing the	ot explain why, tu e tail, instead of	rned	
25X1	this moment, three Lock	e had been, and began a content of the second employees and the second	curity guard bega	At 25×1/	
25×14	emitted by the forklift	did not hear them to and his preoccupation wantil he impacted the right	th the U-2R.	con-/	
25X1/ 25X1/	now and anything they o	ecurity officer.	The initial inter	of 25 X17 one it view the	
25X1/	several Navy trade sch Navy has commended him	he Navy files holds a Top of by the 14th Naval Distriction ools, finishing near the for outstanding education show him as being above-	top of the class. nal achievement.	ased on led The His	
1		1		TOTAL	
:	motorcycle. The other	ar ago and according asions in that time. he was involved in two according two according to the second seco	ntrol of his perso	ving lich a 25X1A	
	with the cover story w	ound the aircraft were le hich in this instance was d to preclude an appearan e project.	USAF. Overt secu	ırity	
25X1/	d conclusions:				
1. was not qualified to drive a forklift in an area crosensitive equipment and personnel.					
	support they were to p	was not a part of the su	took it upon hi	ℹℼ℞℈℟℆℩ℤ	
	FORM 52.5	CI ASSIFICATION	PAGE	NO.	
	8-64 53 a USE PREVIOUS EDITION,	SECRET	Y CONTINUED	2	

Approved For Belease 2002/06/18: CIA-RDP74B00447R000200020007-2 CONTINUATION OF DISPATCH SECRET 553 25X1A 3. The de-emphasis on the overt security aspects of the deployment had a deliberate tendency for everyone to be less attentive to the physical protection of the aircraft. RECOMMENDATIONS: 1. That, providing it is consistent with the cover story, plausible security, the U-2 be protected on future deployments by a rope guard on stanchions with one access point controlled by a security representative, and that strobe lights be placed around the aircraft during the hours of darkness. 2. Insofar as practical and plausible, that movement of equipment around the aircraft be performed only by members of the deployed team. 25X1A Atch: A. Photograph of damaged wing.
B. Sketch and layout at the time of the accident.

53 d USE PREVIOUS EDITION.

SECRET


CIASSIFICATION

PAGE NO.


CONTINUED

3

Δ

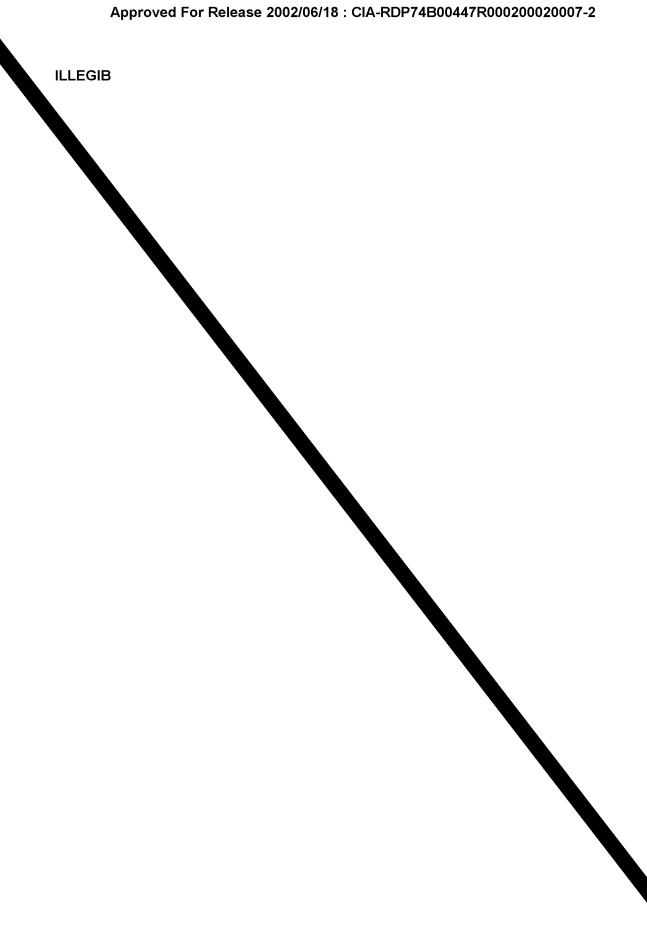



B

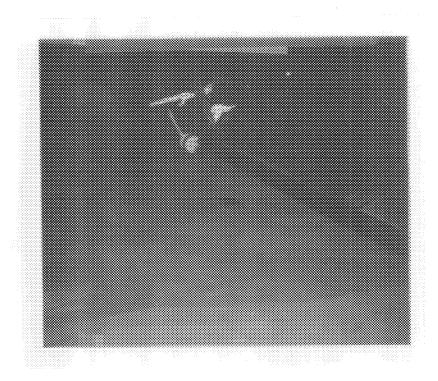





ILLEGIB

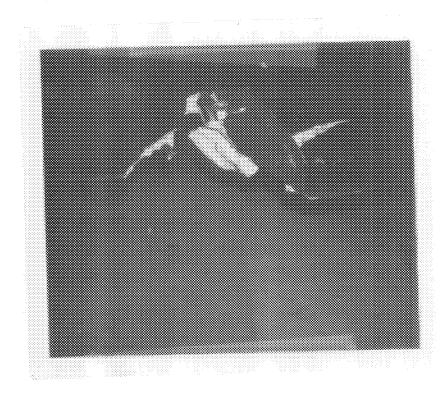

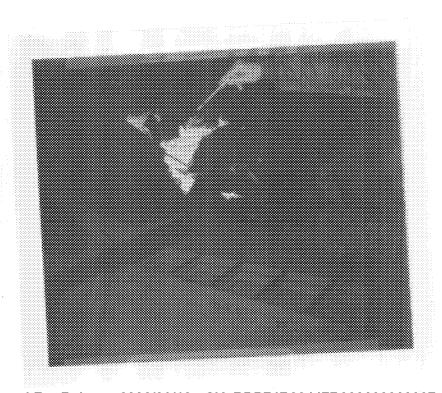

Approved For Release 2002/06/18 : CIA-RDP74B00447R000200020007-2

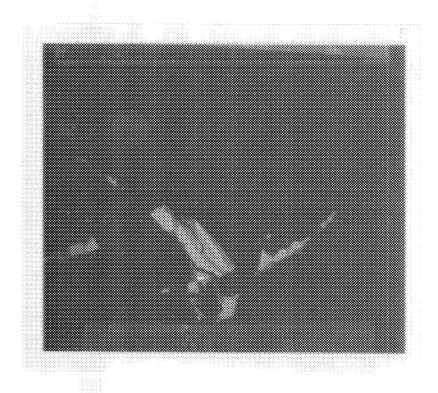


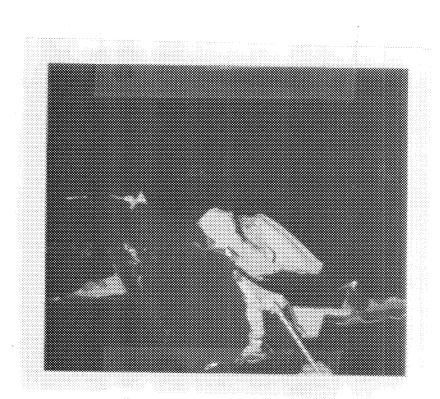


Approved For Release 2002/06/18: CIA-RDP74B00447R000200020007-2

Approved For Release 2002/06/18 : CIA-RDP74B00447R000200020007-2 0200020007-


gree gree

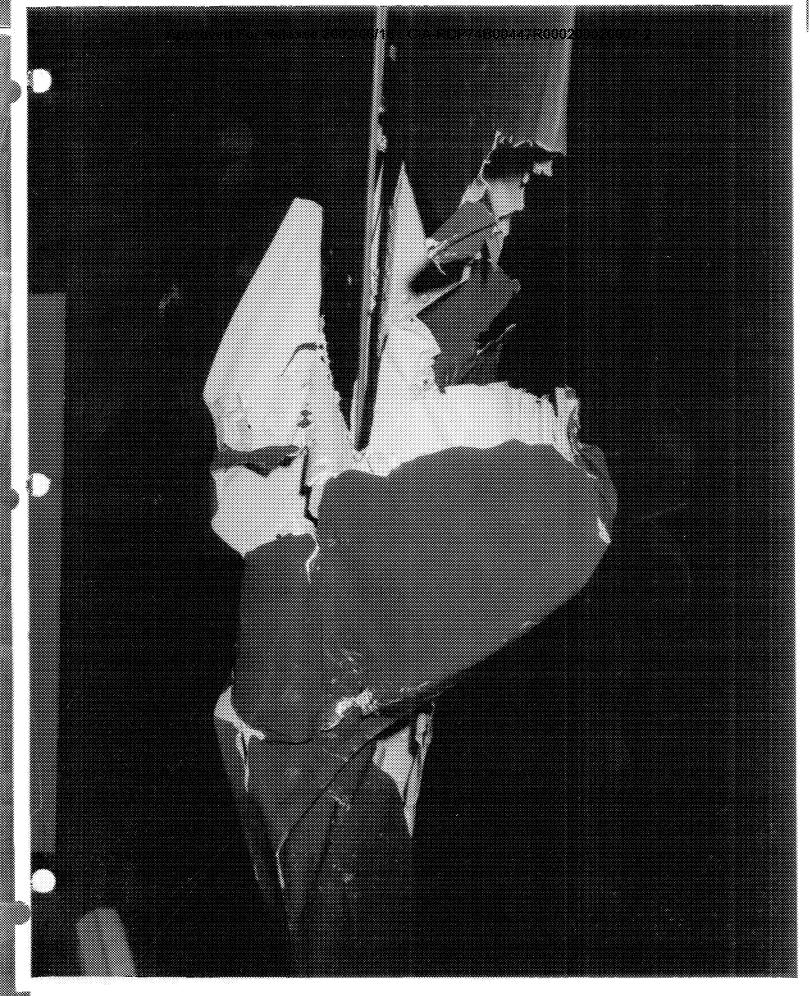


Approved For Release 2002/06/18 : CIA-RDP74B00447R000200020007-2

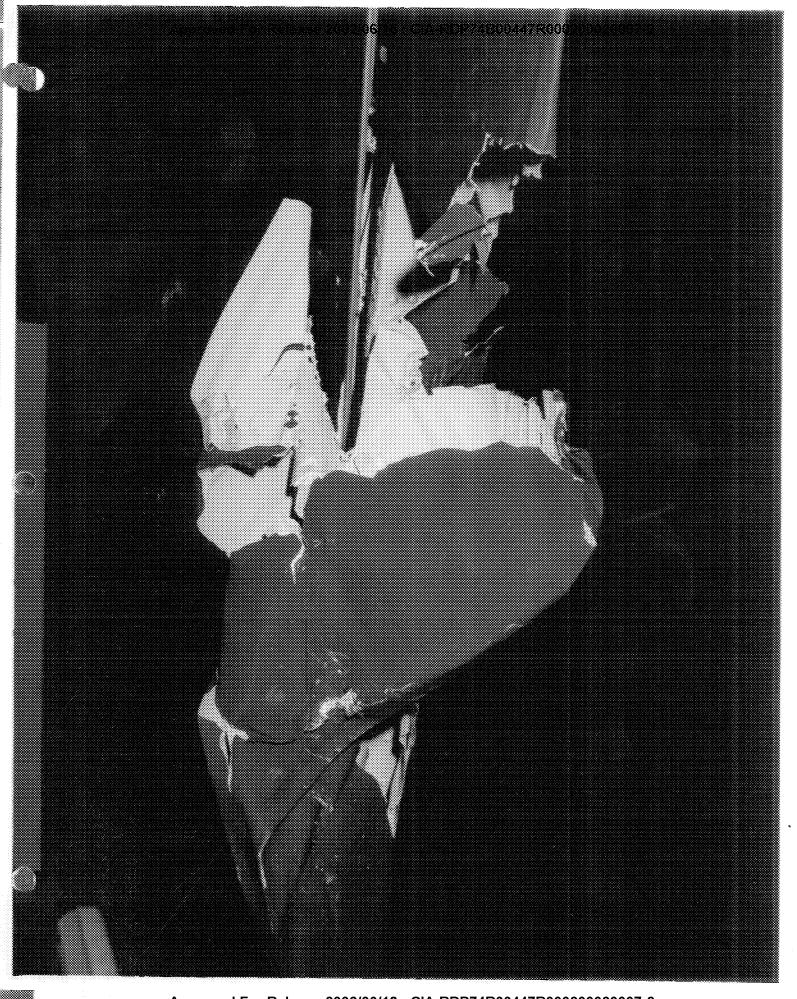


Approved For Release 2002/06/18 : CIA-RDP74B00447R000200020007-2

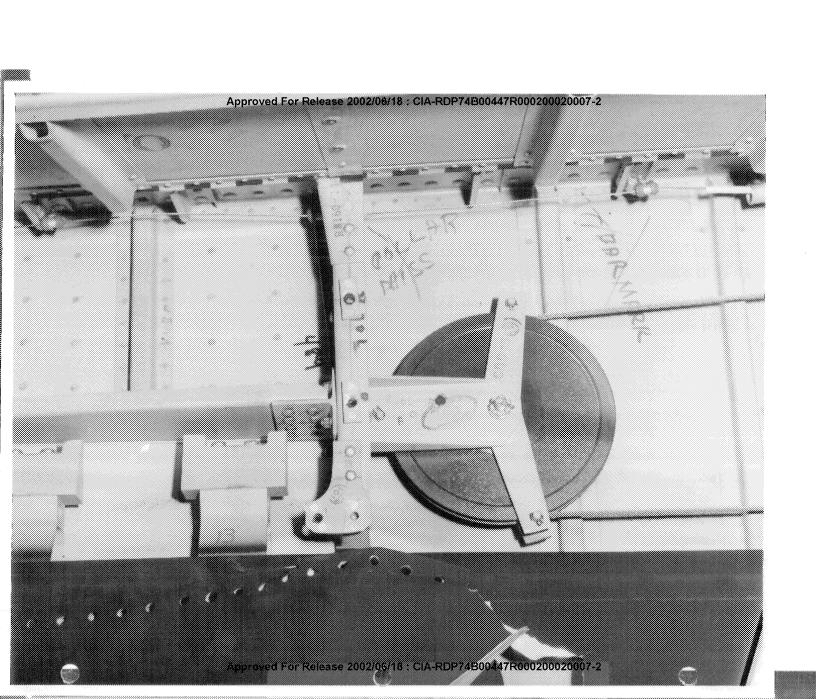

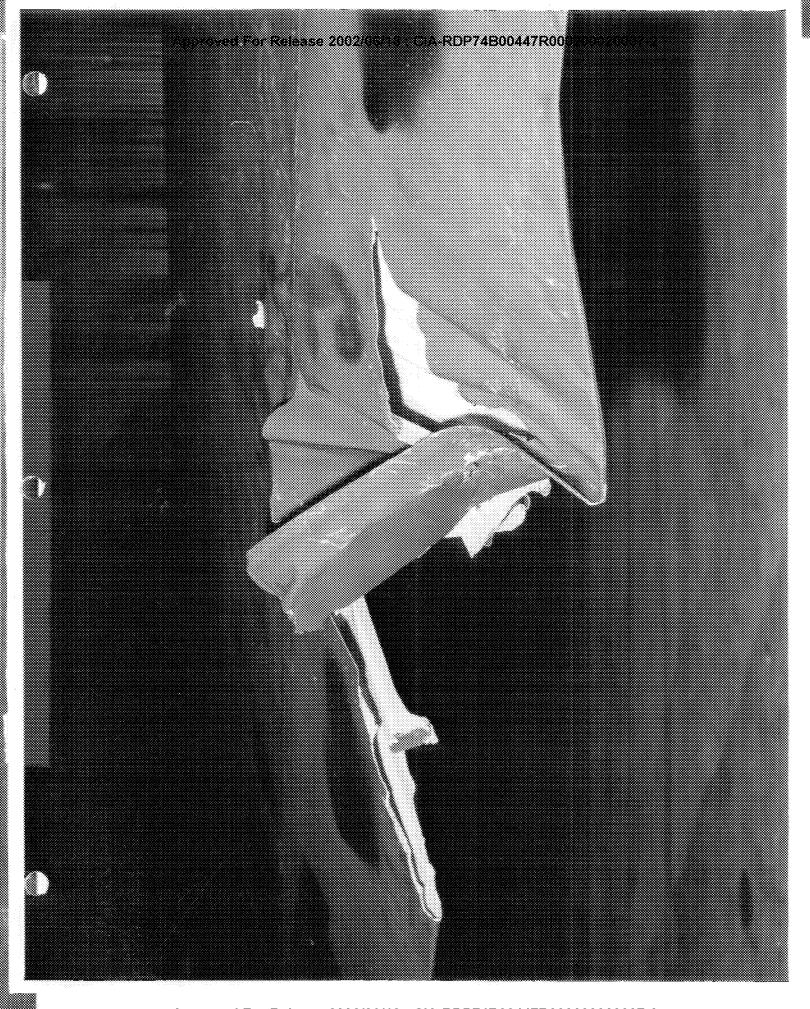

Approved For Release 2002/06/18 : CIA-RDP74B00447R000200020007-2

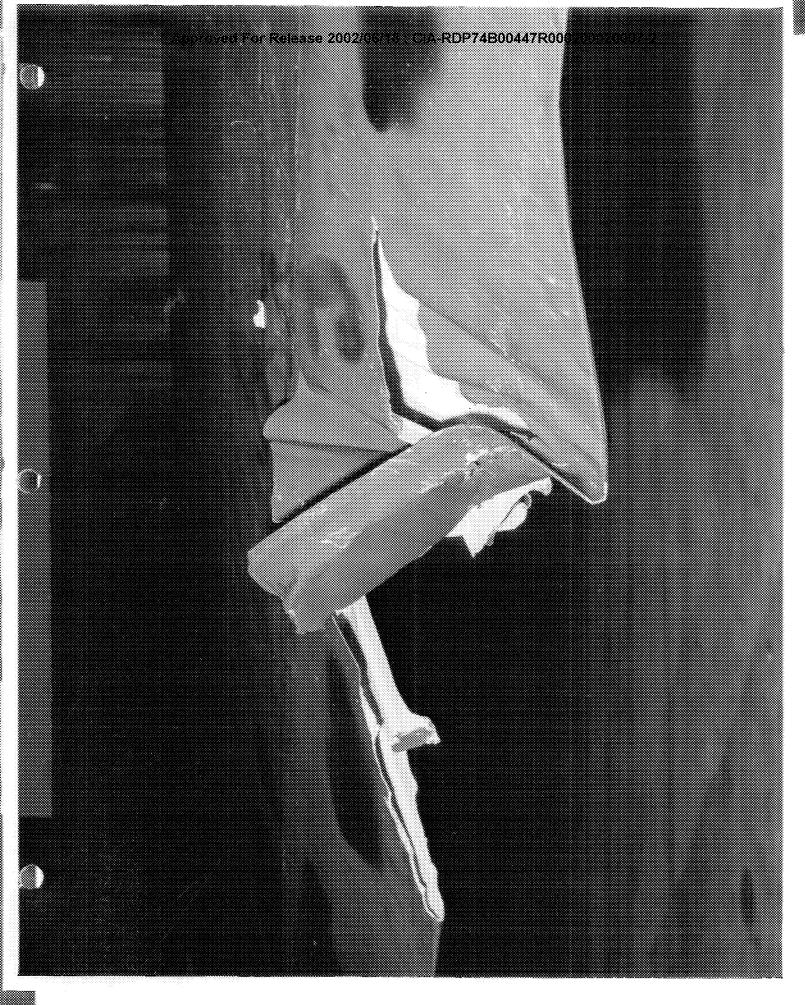

Approved For Release 2002/06/18 : CIA-RDP74B00447R000200020007-2